21 50**Z**

1967 NOV 17

P 172138Z NOV 67 FM NPIC WASHDC TO RUCSAAA/SAC OFFUTT AFB OMAHA NEB RUCVAAA/4080 STRAT WG OL 19 BARKSDALE AFB LA RUCVAAA/2D RTS BARKSDALE AFB LA RUEPJS/DIA WASHDC RUCIJRA/NAVRECONTECHSUPPCEN SUITLAND MD RUWBKNA/15TH AF MARCH AFB RIVERSIDE CALIF RUCVAAA/2 AF BARKSDALE AFB LA RUEFHQA/HQS USAF/AFRDR INFO RUEPIA/CIA WASHDC BT CITE NPIC 2276. SECRET 15TH AF (FOR DI), SAC (GLASS LAMP/DOCR, DM 4) 2D AF (FOR DI).

OUT63620

AFRDR (ATTN:

FROM NATIONAL PHOTOGRAPHIC INTERPRETATION CENTER. 1. CAMERA B-24 WAS USED ON MISSION G994 FLOWN 16 NOVEMBER 1967.

PROCESSING WAS ACCOMPLISHED BY NAV RECON TECH SUPPCEN.

2. ORIGINAL NEGATIVE:

A. THE EXPOSURE AND RESOLUTION WERE GOOD THROUGHOUT FOR

BOTH SIDES.

B. 9R SIDE: SLIGHT INBOARD ROLLER CHATTER IS PRESENT INTERMITTENTLY THROUGHOUT. THE POSITION INDICATORS ARE SHARP; HOWEVER, THEY ARE UNDEREXPOSED. A MANUFACTURER'S SPLICE IS PRESENT IN FRAME 133 AND HEAT SPLICES OCCUR IN FRAME 882 AND BETWEEN FRAMES 1821 AND 1822.

C. 9L SIDE: POSITION INDICATORS ARE READABLE; HOWEVER, THEY APPEAR UNDEREXPOSED. THE DATA BLOCK IS OVEREXPOSED, NOT SHARPLY IMAGED, AND IS DIFFICULT TO READ. THERE IS A MANUFAC-TURER'S SPLICE IN FRAMES 661 AND 1115. HEAT SPLICES ARE PRESENT

IN FRAMES 12, 72, AND 861.

D. BOTH SIDES: ROLLER CHATTER AND EDGE STATIC IS VERY MINOR AND CAUSE NO IMAGE DEGRADATION. FRAME 1920 IS THE LAST TITLED FRAME ON BOTH THE 9L AND 9R SIDES.

3. POSITIVES:

A. PRINTING AND PROCESSING ARE GOOD.


B. PI SUITABILITY IS GOOD THROUGHOUT.

C. CLOUDS OBSCURE APPROXIMATELY 35 PERCENT OF THE MISSION.

GP-1 SECRET

END OF MESSAGE

Declass Review by NGA

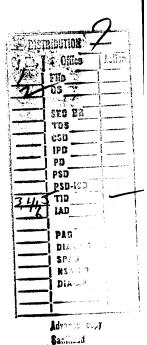

25X2

